


MONUMENT RECORD

Corner ID: Rich_M09

Section Corner

Sections 09, 10, 15, & 16- T09N-R02W, 2nd P.M.
Richland Township, Monroe County, Indiana

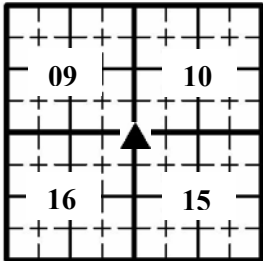

EXISTING SURVEY HISTORY

Include as much detail and history of the corner as known at the time of perpetuation.

ORIGINAL GOVERNMENT SURVEY:

Year Surveyed: *1816* By: *William Harris*
Where filed or recorded: *Original Notes Page 337*
Original monument: *Post*
Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Distance
<i>Beech</i>	<i>12"</i>	<i>N 52° E</i>	<i>11 Links</i>
<i>Ash</i>	<i>30"</i>	<i>S 41° W</i>	<i>16 Links</i>

Notes:

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: *9/17/1984* By: *Edmund O. Farkas*
Where filed or recorded: *M.C.S.O. Records*
Original monument: *Brass Plate & Rod*
Bearing Trees or Reference Monuments:

I.D.	Dia.	Bearing	Distance
<i>PK in P.P.</i>	<i>8"</i>	<i>N 42°30' W</i>	<i>35.95'</i>
<i>PK in P.P.</i>	<i>9"</i>	<i>S 27°30'E</i>	<i>35.75'</i>
<i>"X" on Conc. Post</i>		<i>N 83°30' W</i>	<i>17.54'</i>

Notes:

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: *10/24/2006* By: *Kevin P. Enright*
Where filed or recorded: *M.C.S.O. Records*
Original monument: *Railroad Spike in Brass Plate*
Bearing Trees or Reference Monuments:

I.D.	Dia.	Bearing	Distance
<i>Rebar w/ Cap</i>	<i>5/8"</i>	<i>N 83° W</i>	<i>35.06'</i>
<i>Limestone Post</i>		<i>N 70° E</i>	<i>17.72'</i>
<i>Mag in P.P.</i>	<i>11"</i>	<i>S 68° E</i>	<i>39.50'</i>
<i>Mag in Sign on Post</i>		<i>S 83° E</i>	<i>16.35'</i>

Notes:

SURVEY EVIDENCE FOUND: Include evidence found and weighed, search area or areas, search procedure, etc.
Date of Search: *11/8/21* By: *J.R. & K.H.* Monument Found: *Railroad Spike* BTs or Reference Objects Found: *5/8" Dia. Rebar w/ "Bledsoe-Tapp" Cap, Limestone Post, Mag in SW side of Power Pole, Mag in Wood Post*

OTHER SURVEY HISTORY: Include details such as surveyor name, date, recording info, monument description, etc.

PERPETUATION RECORD

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)
Railroad Spike found 4" below grade in Thomas Road (asphalt)

OTHER EVIDENCE: Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.
Corner is in N-S running centerline of Thomas Road (asphalt), fence intersection to the East of corner

THEORY OF LOCATION: Describe the theory of location for acceptance of this monument with reference to the recording information for the survey upon which this record is derived. Said recorded survey shall be certified by the same professional surveyor who certifies this document, shall identify and accept this monument, and shall have been recorded within (3) years of Form submittal.
Ties prepared by Monroe County Surveyor Edmund O. Farkas show he set a brass plate and rod on September 17th, 1984. Ties prepared by Monroe County Surveyor Kevin P. Enright dated November 30th, 2005 show a railroad spike in a brass plate. Recovered corner witnesses were checked to confirm the location of this railroad spike was in harmony with the location of the railroad spike in brass plate referenced in 2005. This railroad spike was found to be commonly accepted by surveys in the area and was accepted and held.

MONUMENT PRESERVATION: Describe work done to preserve existing monument. Stone mounds should be placed around monuments when stones are readily available. Paint corner stones but not the scribing. A Monroe County "PROTECT NEARBY SURVEY MARKER" sign shall be attached to a steel post when practicable. Note location and relation of corner to sign.
Monroe County "PROTECT NEARBY SURVEY MARKER" sign was found on West side of Wood Post East of corner


GEODETIC COORDINATES: Northing: *1448285.3*, Easting: *3081039.6*

MONUMENT RECORD

Corner ID: Rich_M09

Section Corner

Sections 09, 10, 15, & 16- T09N-R02W, 2nd P.M.
Richland Township, Monroe County, Indiana

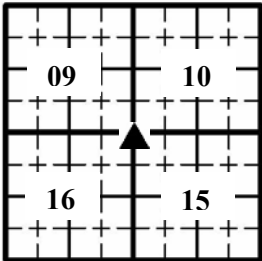

BASIS OF GEODETIC COORDINATES: Describe equipment, date, and personnel used to collect coordinates, datum, epoch, geoid and zone.

Coordinates shown hereon were obtained from GPS observations utilizing the Indiana Real-Time Network (INCORS). Indiana West Zone, NAD83(2011) Epoch 2010.0000, State Plane Grid Coordinates, US Survey Feet. Geoid model G2012BU7. Datum NAD83_NO_TRANS by Jackson Rogers and Eric Deckard on November 8th, 2021.

WITNESS MONUMENT TIES: Describe at least three new BT's and/or witness objects established or work done to preserve existing evidence. The following procedures are provided for guidance. Please utilize professional judgment when choosing witness ties. All ties to BT's should be a magnetic nail and washer (state what kind) set in a hack mark at root crown (less than 12” above ground) perpendicular to center of tree unless otherwise noted. All monuments should be tied to at least three accessories with a minimum of 60° of separation. BTs should be healthy with a minimum DBH of 4”. BT description should include tree species, diameter at 4.5’ above ground, distance of nail above ground, and description of nail location (e.g., SE side of root). Note bearing from monument to the center of the BT, distance to the nail. Other survey monuments that were located in the vicinity and their relation to the monument may also be included.

ID	Bearing	Distance	Description
<i>B</i>	<i>N 88°45'31" W</i>	<i>35.12’</i>	<i>5/8” Dia. Rebar with “Bledsoe-Tapp” cap (GPS measurement)</i>
<i>C</i>	<i>N 70° E</i>	<i>17.72’</i>	<i>Southwest corner of Limestone Post</i>
<i>D</i>	<i>S 68° E</i>	<i>39.50’</i>	<i>Mag nail 0.2’ A.G. in SW side of Power Pole</i>
<i>E</i>	<i>S 83° E</i>	<i>16.20’</i>	<i>Mag nail w/ washer set 12” A.G. in Wood Post</i>

MONUMENT LOCATION SKETCH: Optional: Attach a sketch or aerial image. Monument sketch is not required for reimbursement.

PHOTO IDENTIFIED: Photograph close up photo of monument and a vicinity photo of the monument that includes the Monroe County “PROTECT NEARBY SURVEY MARKER” sign. Provide photo orientation and date. Additional photos may be included by clicking the “+” button at the end of the horizontal line.
Photo Date: *November 2021*



Photo Orientation & Description: *Looking East at M-09*




Photo Orientation & Description: *Looking South at M-09*

MONUMENT RECORD

Corner ID: Rich_M09

Section Corner

Sections 09, 10, 15, & 16- T09N-R02W, 2nd P.M.
Richland Township, Monroe County, Indiana

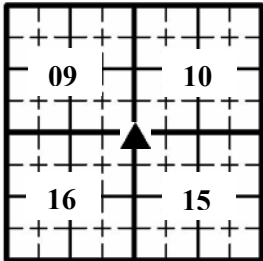

FIELD PERSONNEL:

Field Date: 11/8/2021 By: J.R. & E.D. Project #: 21-157 Field Book: , page: Notes:

CERTIFICATION:

Professional Surveyor Name: Eric L. Deckard
Indiana Professional Surveyor No.: 29900012
Firm Name: Deckard Land Surveying
Date: 12/03/21

Signature:

Signature:



Seal:

OFFICE USE ONLY

NOTICE TO PROCEED AND MONUMENT RECORD FORM ISSUED TO:			
Offeror Name: Eric L. Deckard		Firm Name: Deckard Land Surveying, LLC	
Phone: (812)961-0235		Email: Ericdeckard1@msn.com	
Corner Classification: Section Corner		Corner Coordinate Status: Perpetuated	
Issue Date: 7/12/22	Form Due Date: 7/21/22	Form Receipt Date: 7/21/2022	

COUNTY SURVEYOR APPROVAL:		Seal:
<input checked="" type="checkbox"/> Yes, Signature:	Date: 7/19/22	
<input type="checkbox"/> No, reasons for denial		

SURVEYOR REVIEW BOARD APPROVAL:		Seal:
<input checked="" type="checkbox"/> Yes, Signature:	Date: 7/19/22	
<input type="checkbox"/> No, reasons for denial		